

# PISTOL PRO 700 **USER'S MANUAL**

## Safety Precautions

- Do not pressurize with any gas
- Do not pressurize an empty tank.
- Open tank cap slowly to release air before removing; keep bottle upright when releasing pressure
- Do not transport while pressurized.
- Do not treat voids with electrical outlets or cables.
- The end of wood-injection tip is sharp and must be handled with care.



## Before Starting



- Engage the safety lock on the gun valve.
- Tighten bottle until snug. do not over-tighten

### 700 Series Models



#### 4-Wav. C+C Tip

For typical pest control operations, indoors and outdoors.

### Foaming Tip

 Add foaming agent to liquid insecticide to produce foam, tip adjusts to produce thick or limited foam. Suitable for treating floor drains with the B&G microbial cleaner, MicroFoam EF for small fly control.

#### **Wood-Injection Tip**

 Suitable for penetrating surface of infested wood to intersect insect galleries; this tip delivers foam or liquid.

• Drill a 1/16 in. hole into the wood surface or push the pointed tip through wood surface into gallery.




## Operating Instructions


#### Filling Bottle (1 pint, 1 quart)

- To ensure adequate air pressure in bottle, do not fill to the top of the bottle, allow 1/3 of bottle for head space.
- Foaming agent must be added to bottle of the Foaming Tip Model.
- Mix and use all insecticides in accordance with label directions.

#### **Pressurizing**














### Care and Maintenance

- Flush bottle, valve, and siphon tube with clean water regularly.
- Inspect and clean the tip of the siphon tube regularly.
- · Clean the filter in front of the soft seat gasket regularly.
- · Protect application tips when not in

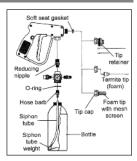

## **Trouble Shooting**

**Problem:** Gun is leaking from: 1) the front of the tip, or,

2) behind the tip

Solution: 1) Tighten tip retainer, clean nozzle

2) Clean or replace soft seat gasket

Solution:

**Problem:** Leaking at bottom of the gun or the top of the bottle

Tighten reducing nipple connection

 Tighten hose barb, check o-ring for damage or replace

Replace Teflon tape

Extenda-Ban valve or tip on Pistol Pro Platinum Problem:

 Tighten packing nut on valve Solution:


· Replace packing washers in valve

Problem: Solution:


Foam from foaming tip is watery or not thick enough

Add more foaming agent to bottle

Clean the siphon tube with fresh water

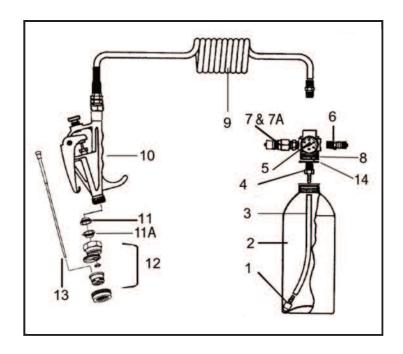

B&G Help Line 800-544-8811

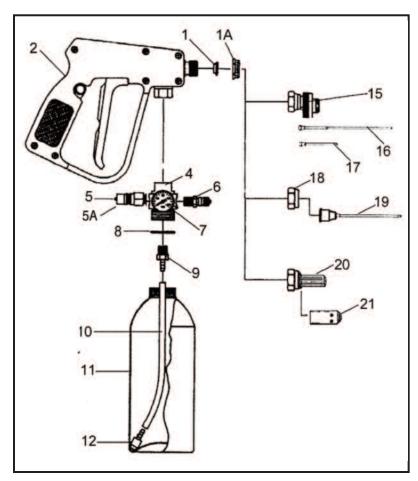

### **PISTOL PRO PLATINUM**

#	Part #	Description
1	24013050	Siphon weight
2	24010710	Bottle + cap, 1 pint
	24010715	Bottle + cap, 1 quart
3	24013052	Siphon hose, 1 pint
	24010039	Siphon hose, 1 quart
4	24013050	Hose barb fitting
5	24010003	Gauge, 160 psi
6	22054900	Air valve
7	22071801	Quick Connect Plug
7A	22026700	1/8" pipe nipple
8	24010016	Adapter
9	22072098	Coiled hose assembly
10	M-22055445	2206 brass valve
11	22046300	Soft seat gasket
11A	22032720	200 mesh screen
12	22049468	5850 tip assembly
13	22049200	5700-B tip extension
14	24010002	0-ring



135 REGION SOUTH DRIVE • JACKSON, GA 30233
Toll Free 800-544-8811 • Phone 678-688-5601
www.bgequip.com • Fax 678-688-5633

### **PISTOL PRO 700 SERIES**

#	Part #	Description
1	22046300	SP-159 soft seat gasket
1A	22032720	200 mesh screen
2	22067312	30-L Gunjet
4	24010051	Adapter
5	22071801	Quick connect
5A	22026700	Nipple pipe 1/8"
6	22054900	Air valve
7	24010003	Gauge, 160 psi
8	24010002	0-ring
9	24013050	Hose barb fitting
10	24013052	Siphon hose, 1 pint
10	24010039	Siphon hose, 1 quart
11	24010710	Bottle + cap, 1 pint
	24010715	Bottle + cap, 1 quart
12	24013050	Siphon weight
15	22049468	5850CC tip assembly
16	22049200	5700-B tip ext
17	22071785	5700-2 void tip 2"
18	22033100	TC-160 tip cap
19	24010059	Needle assembly
20	23083601	Adjusting nozzle
21	22036655	Foam tip assembly